


Branch Tees

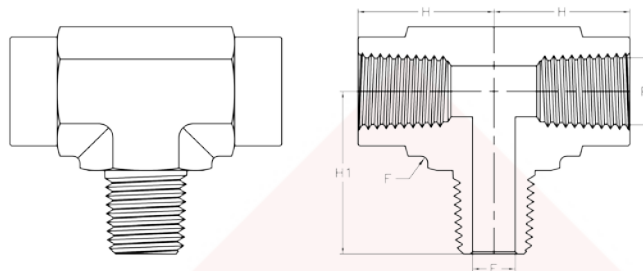

Female to Male NPT

RELYLOK Basic Part No.	P - Female & Male NPT in.	H in. [mm]	H1 in. [mm]	E in. [mm]	F Hex	Max. Working Pressure psig [bar]	
						SS & CS	Brass
-1-BT	1/16	0.66 [16.8]	0.72 [18.3]	0.12 [3]	9/16	7700 [531]	3850 [265]
-2-BT	1/8	0.66 [16.8]	0.78 [19.8]	0.19 [4.8]	9/16	5500 [379]	2750 [190]
-4-BT	1/4	0.88 [22.4]	1.09 [27.7]	0.28 [7.1]	3/4	5600 [386]	2800 [193]
-6-BT	3/8	1.02 [25.9]	1.22 [31]	0.38 [9.7]	7/8	5000 [345]	2500 [172]
-8-BT	1/2	1.23 [31.2]	1.47 [37.3]	0.47 [11.9]	1-1/16	4500 [310]	2250 [155]
-12-BT	3/4	1.36 [34.5]	1.59 [40.4]	0.62 [15.7]	1-5/16	3500 [241]	1750 [121]
-16-BT	1	1.63 [41.4]	1.97 [50]	0.88 [22.4]	1-5/8	3900 [269]	1950 [134]
-20-BT	1-1/4	1.70 [43.2]	2.38 [60.5]	1.09 [27.7]	1-7/8	3100 [214]	1550 [107]

Female to Male BSP/ISO taper (PT)

RELYLOK Basic Part No.	P - Female & Male BSPT/ISOT in.	H in. [mm]	H1 in. [mm]	E in. [mm]	F Hex	Max. Working Pressure psig [bar]	
						SS & CS	Brass
-1PT-BT	1/16	0.66 [16.8]	0.72 [18.3]	0.12 [3]	9/16	7700 [531]	3850 [265]
-2PT-BT	1/8	0.66 [16.8]	0.78 [19.8]	0.19 [4.8]	9/16	5500 [379]	2750 [190]
-4PT-BT	1/4	0.88 [22.4]	1.09 [27.7]	0.28 [7.1]	3/4	5600 [386]	2800 [193]
-6PT-BT	3/8	1.02 [25.9]	1.22 [31]	0.38 [9.7]	7/8	5000 [345]	2500 [172]
-8PT-BT	1/2	1.23 [31.2]	1.47 [37.3]	0.47 [11.9]	1-1/16	4500 [310]	2250 [155]
-12PT-BT	3/4	1.36 [34.5]	1.59 [40.4]	0.62 [15.7]	1-5/16	3500 [241]	1750 [121]
-16PT-BT	1	1.63 [41.4]	1.97 [50]	0.88 [22.4]	1-5/8	3900 [269]	1950 [134]
-20PT-BT	1-1/4	1.70 [43.2]	2.38 [60.5]	1.09 [27.7]	1-7/8	3100 [214]	1550 [107]

See Ordering Information and Technical Specifications on page 2.