


## Pipe Crosses

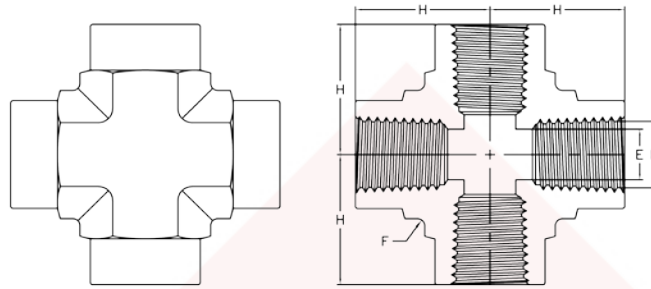

### Female NPT

RELYLOK Basic Part No.	P - Female NPT in.	H in. [mm]	E in. [mm]	F Hex	Max. Working Pressure psig [bar]	
					SS & CS	Brass
-1-CS	1/16	0.50 [12.7]	0.25 [6.4]	7/16	7000 [483]	3500 [241]
-2-CS	1/8	0.66 [16.8]	0.34 [8.6]	9/16	5500 [379]	2750 [190]
-4-CS	1/4	0.88 [22.4]	0.45 [11.4]	3/4	5600 [386]	2800 [193]
-6-CS	3/8	1.02 [25.9]	0.59 [15]	7/8	5000 [345]	2500 [172]
-8-CS	1/2	1.23 [31.2]	0.73 [18.5]	1-1/16	4500 [310]	2250 [155]
-12-CS	3/4	1.36 [34.5]	0.94 [23.9]	1-3/8	3500 [241]	1750 [121]
-16-CS	1	1.63 [41.4]	1.17 [29.7]	1-5/8	3900 [269]	1950 [134]
-20-CS	1-1/4	1.70 [43.2]	1.50 [38.1]	1-7/8	3100 [214]	1550 [107]
-24-CS	1-1/2	2.08 [52.8]	1.73 [43.9]	2-1/2	2500 [172]	1250 [86]
<b>10000 psig [689 bar]</b>						
-4-CS-XK	1/4	1.23 [31.2]	0.45 [11.4]	1-1/16	10000 [688]	NA
-8-CS-XK	1/2	1.63 [41.4]	0.73 [18.5]	1-5/8		

### Female BSP/ISO taper (PT)

RELYLOK Basic Part No.	P - Female BSPT/ISOT in.	H in. [mm]	E in. [mm]	F Hex	Max. Working Pressure psig [bar]	
					SS & CS	Brass
-1PT-CS	1/16	0.50 [12.7]	0.25 [6.4]	7/16	7000 [483]	3500 [241]
-2PT-CS	1/8	0.66 [16.8]	0.34 [8.6]	9/16	5500 [379]	2750 [190]
-4PT-CS	1/4	0.88 [22.4]	0.45 [11.4]	3/4	5600 [386]	2800 [193]
-6PT-CS	3/8	1.02 [25.9]	0.59 [15]	7/8	5000 [345]	2500 [172]
-8PT-CS	1/2	1.23 [31.2]	0.73 [18.5]	1-1/16	4500 [310]	2250 [155]
-12PT-CS	3/4	1.36 [34.5]	0.94 [23.9]	1-3/8	3500 [241]	1750 [121]
-16PT-CS	1	1.63 [41.4]	1.17 [29.7]	1-5/8	3900 [269]	1950 [134]
-20PT-CS	1-1/4	1.70 [43.2]	1.50 [38.1]	1-7/8	3100 [214]	1550 [107]
-24PT-CS	1-1/2	2.08 [52.8]	1.73 [43.9]	2-1/2	2500 [172]	1250 [86]
<b>10000 psig [689 bar]</b>						
-4PT-CS-XK	1/4	1.23 [31.2]	0.45 [11.4]	1-1/16	10000 [689]	NA
-8PT-CS-XK	1/2	1.63 [41.4]	0.73 [18.5]	1-5/8		

See Ordering Information and Technical Specifications on page 2.